



BIOS Update Release Notes

PRODUCTS: NUC6CAYS, NUC6CAYH (Standard BIOS)

BIOS Version 0043 - AYAPLCEL.86A.0043.2017.1123.1559

About This Release:

- Date: November 23, 2017
- TXE Firmware: 3.1.50.2222
- EC Firmware: 20.00
- Memory Reference Code: Based on 1.2.3
- Integrated Graphics:
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1036
- LAN Option ROM: PXE-2.1 (build 083)
- Visual BIOS: 2.2.23

New Fixes/Features:

- Updated the EC version to version 20.
- Fixed the issue that when the power adapter is dis-connected and reconnected when the NUC was in S3, it would enter into "Deep S4/S5" mode.

BIOS Version 0042 - AYAPLCEL.86A.0042.2017.1117.1918

About This Release:

- Date: November 17, 2017
- TXE Firmware: 3.1.50.2222
- EC Firmware: 19.00
- PMC Firmware: 3.1a
- Framework Reference Code: Based on 1.2.3
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1036
- LAN:
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23

New Fixes/Features:

- Updated Trusted Execution Engine Firmware to version: 3.1.50.2222 (Security Advisory-00086).
- Due to a security enhancement, it will not be possible to go to any BIOS earlier than BIOS 0042.
- Updated the EC version to fix an issue where the NUC couldn't be woken up with a XBOX One or XBOX 360 remote.

BIOS Version 0041 - AYAPLCEL.86A.0041.2017.0825.1152

About This Release:

*Other names and brands may be claimed as the property of others.

- Date: August 25, 2017
- TXE Firmware: 3.0.13.1144
- EC Firmware: 18.00
- PMC Firmware: 3.1a
- Framework Reference Code: Based on 1.2.3
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1036
- LAN:
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23

New Fixes/Features:

- Security enhancements.
- Add setup item: "Allow UEFI 3rd party driver loaded".
- Fixed an issue where the system would not auto power on after a power failure and deep S4/S5 is enabled.

BIOS Update 0040 - AYAPLCEL.86A.0040.2017.0619.1722
--

About This Release:

- Date: June 19, 2017
- TXE Firmware: 3.0.13.1144
- EC Firmware: 18.00
- PMC Firmware: 3.1a
- Framework Reference Code: Based on 1.2.3
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1036
- LAN
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23

New Fixes/Features:

- Implemented BIOS recovery feature through EC initialization.
- Fixed the issue where the system would stop at POST code 9Ah if executing an EFI file over 300 MB.
- Fixed the issue where a USB wired mouse would move slowly after upgrading the BIOS to AY0024.
- Updated the EC version to version 18.0
- Fixed the LED effect when changing the always on mode to, low brightness slow fade mode.
- Implemented error message when trying to use the wrong BIOS.
- Fixed the issue where the LED button flashes abnormally while updating the BIOS.

BIOS Version 0038 - AYAPLCEL.86A.0038.2017.0310.1633

About This Release:

- Date: March 10, 2017
- TXE Firmware: 3.0.13.1144
- EC Firmware: 16.00
- PMC Firmware: 3.1a

*Other names and brands may be claimed as the property of others.

- Framework Reference Code: Based on 1.2.3
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1036
- LAN
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23

New Fixes/Features:

- Changed RTD3 Setup item to be disabled on default.
- Changed the EC so that it cannot be downgraded.
- Updated the EC to version 16.0.
- Updated the GOP.
- Updated new LED items.
- Added CEC help strings in BIOS setup menu.
- Enabled LPC CLKRUN number.
- Fixed issue where waking on USB from S5 would fail.
- Updated Apollo Lake smart sound technology.
- Fixed an issue where the system wouldn't boot if the startup sound was enabled or disabled via the BIOS setup menu.
- Fixed an issue where the UEFI SD card boot item is incorrect when the BIOS is set to legacy and UEFI boot.
- Updated the TXE to version 3.0.13.1144.
- Added more compatibility for ITK tool
- Fixed an issue where the NUC will not boot if shift+F10 are pressed and the Expansion card text is set to "Hide All", when the BIOS is set to legacy and UEFI boot.
- Fixed an issue where the SD card reader subsystem will display incorrectly after resuming from S3
- Fixed an issue where the rear USB 3.0 port would still detect a USB flash device when set to "Disabled".
- Fixed an issue where the Secure Jump Menu couldn't be suppressed.
- Fixed an issue where the Expansion Card Text would not show anything.
- Fixed an issue where Intel Boot Agent GE setup menu would not show anything.
- Updated the Apollo Lake label.
- Updated the Apollo Lake Framework BIOS Reference Code.
- Updated the CPU microcode.
- Updated the PMC firmware.
- Fixed an issue where the system always booted to the UEFI shell first.
- Fixed an issue where there would be no error message if fast boot failed on the previous boot.
- Fixed an issue where the maximum temperature setting of the fan, in custom mode, would not fill in the EC register correctly.
- Fixed an issue where, "The fixed mode default duty cycle" was incorrect.
- Fixed an issue where "Type 10: Intel High Definition Audio Device" needed to say, "Realtek High Definition Audio".

*Other names and brands may be claimed as the property of others.

BIOS Version 0029 - AYAPLCEL.86A.0029.2016.1124.1625

About This Release:

- Date: November 24, 2016
- TXE Firmware: 3.0.11.1131
- Framework Reference Code: Based on 1.2.1
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1035
- LAN
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23
- PMC FW rev : 3.19
- EC FW rev : 14.00

New Fixes/Features:

- Fixed issue where the system would always first boot to UEFI shell in BIOS 0028.
- Fixed issue where no error message would occur if the previous fast boot failed. Added maximum temperature for fan custom mod.

BIOS Version 0027 - AYAPLCEL.86A.0027.2016.1108.1529

About This Release:

- Date: November 08, 2016
- TXE Firmware: 3.0.11.1131
- Framework Reference Code: Based on 1.2.1
- Integrated Graphics
 - Option ROM: Build 1016 PC 14.34
 - UEFI Driver: 10.0.1035
- LAN
 - Option ROM: PXE-2.1 (build 083)
- Visual Bios: 2.2.23
- PMC FW rev : 3.19
- EC FW rev : 13.00

New Fixes/Features:

- Initial production BIOS release

LEGAL INFORMATION

Information in this document is provided in connection with Intel Products and for the purpose of supporting Intel developed server/desktop boards and systems.

No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel Corporation may have patents or pending patent applications, trademarks, copyrights, or other intellectual property rights that relate to the presented subject

*Other names and brands may be claimed as the property of others.

matter. The furnishing of documents and other materials and information does not provide any license, express or implied, by estoppel or otherwise, to any such patents, trademarks, copyrights, or other intellectual property rights. Intel products are not intended for use in medical, life saving, or life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice.

Intel is a trademark of Intel Corporation in the US and other countries.
Copyright (c) 2015 Intel Corporation.

*Other names and brands may be claimed as the property of others.