


October 2021

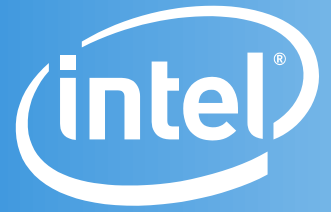

Release Notes

Intel® Killer Performance Suite 3.1121.936

Supported Operating Systems

Microsoft Windows 10® and Windows 11® (64 Bit only)

Supported Products and Driver Versions

<i>Intel® Wireless Adapter</i>	<i>Driver version</i>
Intel® Killer Wireless-AC 1550	22.80.1.1
Intel® Killer Wi-Fi 6 AX1650	
Intel® Killer Wi-Fi 6e AX1675	
Intel® Killer E3100 2.5Gb Ethernet	1.0.2.14
Intel® Killer E3100x 2.5 Gb Ethernet	
Killer E3000 2.5Gb Ethernet	10.050.0511.2021
Killer E3100G 2.5Gb Ethernet	
Killer E2500v2 1Gb Ethernet	10.050.0511.2021
Killer E2600 1Gb Ethernet	
Killer Networking Software	3.1121.927.5

Note: This Software Release version does not include new drivers for the Killer E2200, Killer E2400, Killer E2500, Killer 1525 Wireless, Killer 1535 Wireless, Killer 1435 Wireless, or the Killer AX500 Wireless adapters, but the Killer Networking Software is can be installed on the systems with the above adapters.



Key Issues Fixed and Changes: Package Version 3.1121.936

Description of Key Issue
Updated Wi-Fi driver to version 22.80.1.1
Updated Killer Networking Software to version 3.1121.927.5

Key Issues Fixed and Changes: Wi-Fi Driver 22.80.1.1

Description of Key Issue	OS
Device Manager shows wireless device yellow exclamation mark (yellow bang) code 10 error when playing online videos.	Win10
File transfers fail when using Samsung* "QuickShare" software sending data between a laptop and a phone.	Win10
Network connectivity loss (Windows System Event ID 5002) occurs when hosting a mobile hotspot on Intel Dual Band Wireless AC-8265 and AC-8260 adapters.	Win10
Intel Dual Band Wireless AC-8265 and AC-8260 adapters fail to receive 802.11 Control frames transmitted at rates greater than 24 Mbps.	Win10
Support for Windows® 11 added since Intel® PROSet/Wireless Software 22.70.0	Win 11
Intel® PROSet/Wireless Software 22.80.1 has been updated to include functional and security updates. Users should update to the latest version.	Win10/Win11

Note: Key issues fixed in the OS indicated in the table above

Key Issues Fixed and Changes: Ethernet Driver 1.0.2.14

Description of Key Issue
Added support for Windows 11

Key Issues Fixed and Changes: Ethernet Driver 10.050.0511.2021

Description of Key Issue
Updated idle power parameters
Improved wake on LAN functionality
Added support for Windows 11

Key Issues Fixed and Changes: Killer Networking Software 3.1121.927.5

Description of Key Issue
Slow receive on Intel WiFi adapter when Killer Networking Software installed on Windows 11 OS, specifically when using YouTube, Facebook, Amazon Prime Video as well as real-time communication services.



Legal Notices

No license (express or implied, by estoppel or otherwise) to any of Intel's intellectual property rights is granted by this document.

Intel disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade.

This document contains information on products, services and/or processes in development. All information provided here is subject to change without notice. Contact your Intel representative to obtain the latest forecast, schedule, specifications and roadmaps.

The products and services described may contain defects or errors known as errata which may cause deviations from published specifications. Current characterized errata are available on request.

Intel technologies' features and benefits depend on system configuration and may require enabled hardware, software or service activation. Performance varies depending on system configuration.

No computer system can be absolutely secure. Check with your system manufacturer or retailer or learn more at intel.com.

Tests document performance of components on a particular test, in specific systems. Differences in hardware, software, or configuration will affect actual performance. Consult other sources of information to evaluate performance as you consider your purchase. For more complete information about performance and benchmark results, visit <http://www.intel.com/performance>.

Copies of documents which have an order number and are referenced in this document may be obtained by calling 1-800-548-4725 or by visiting www.intel.com/design/literature.htm.

Intel and the Intel logo are trademarks of Intel Corporation in the U.S. and/or other countries.

*Other names and brands may be claimed as the property of others

The Bluetooth® word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. and any use of such marks by Intel is under license.

©February 2021 Intel Corporation.

